

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
MGF

Bulletin N°: 0008
CDS. ref: M8377bu
Issue: 1
Date: 6.05.98

AFFECTED RANGE:
All vehicles up to Vin 036126

PROBLEM:
STOP LAMPS REMAIN ON - PEDAL SWITCH OVER ADJUSTING

CAUSE:
Unnatural upward movement of brake pedal causes brake switch self adjuster to over adjust. This condition can occur if driver unintentionally lifts pedal with foot.

ACTION:
Replace the original brake light switch XKB 100080 for alternative switch part number XKB 10003. This switch is non self adjusting and will require a different fitting procedure to that provided in the workshop manual.

Switch replacement and setting:

1. Release original switch XKB 10008 from bracket, disconnect electrical connections then remove and discard switch.
2. Remove one of the black plastic sleeves from the electrical connector.
3. Reconnect the electrical connections to new switch XKB 10003.
4. Assemble the 7 washers to new switch.
5. Hold switch in fitted position but do not fit brass nut.
6. Switch ignition on and ask assistant to check for brake light operation.

